


穿線方法

請確實按照圖示各種不同縫合情況穿線，錯誤之穿線將引起斷線、跳針及車縫不平坦等現象。(圖11)

THREADING

Follow the procedures shown in (Fig 9) for threading. Wrong threading may cause thread breaking, stitch skipping, puckering or unexpected sewing. (Fig. 11)

四針穿線圖 For four thread only

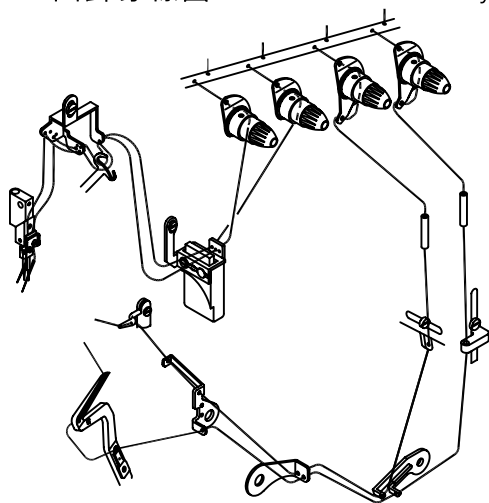

包縫穿線圖 For seam type 516 only

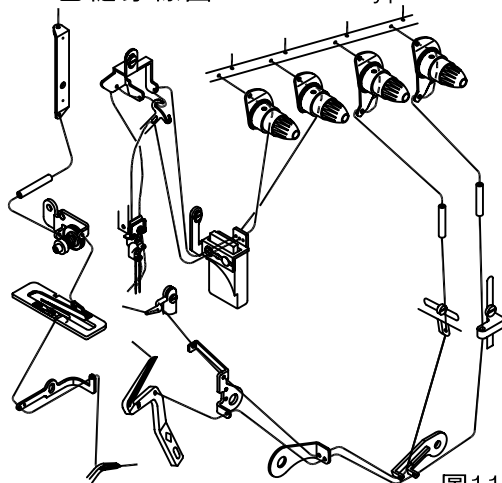


圖11/Fig. 11